

\$ UNITEC

[illegible]

Part and Drawing Number

Pneumatic- Magnetic Drilling Machine

[illegible]

Spare Part List

Description:

Part and Drawing Number

2 1330 1000

Pneumatic Motor

Item	Qty.	Description	Part and Drawing No.		Remarks
101	1	Motor housing, Assy.	2 1330 1910		With item 102,118, 121,123,140,141, 149
102	2	Silencer	2 1330 1700		
103	4	Belleville spring washer	9 1801 0320		
	2	End plate, Assy.	3 8741 1940	*	item 104-107
104	1	End plate	3 8741 1110		
105	1	Grooved ball bearing	9 1001 0370		
106	1	Snap ring	9 1703 0040		
107	1	Spacer ring	1 1001 1080		
108	2	Cylinder bushing	5 6050 1020	*	
109	2	Brace	9 1630 1060		
110	2	Rotor	2 1330 1030	*	
111	10	Vane	3 7666 1050	*	
	2	End plate, Assy.	7 1403 1930	*	item 112-115
112	1	End plate	7 1403 1100		
113	1	Grooved ball bearing	9 1001 0460		
114	1	Snap ring	9 1703 0350		
115	1	Spacer ring	1 3801 1080		
116	2	Cover	2 1330 1150	*	
117	2	O-Ring	9 1901 2380	*	
118	1	Motor housing cover	2 1330 1130		
119	1	Shaft sealing ring	9 1905 1390		
120	1	Grooved ball bearing	9 1005 0350		
121	4	Fillister-head screw	9 1110 3030		
122	2	Silencer sintered metal	9 3801 1030	*	
123	1	Adapter sleeve	9 1630 0560		
	2	Gearbox set	2 1330 4900		item 130-137
130	1	Rim of the gear	2 1330 4020		
131	1	Grooved ball bearing	9 1003 0340		
132	1	Planetary wheel carrier	2 1330 4130		
133	3	Planetary wheel	2 1330 4140		
134	3	Needle roller	9 1016 0340		
135	1	Grooved ball bearing	9 1003 0340		
136	3	Needle cage	9 1015 0950		

[illegible]

* Wear and tear parts to be stored in case of continuous use
--


Spare Part List

Description:

Pneumatic Motor

Part and Drawing Number

2 1330 1000

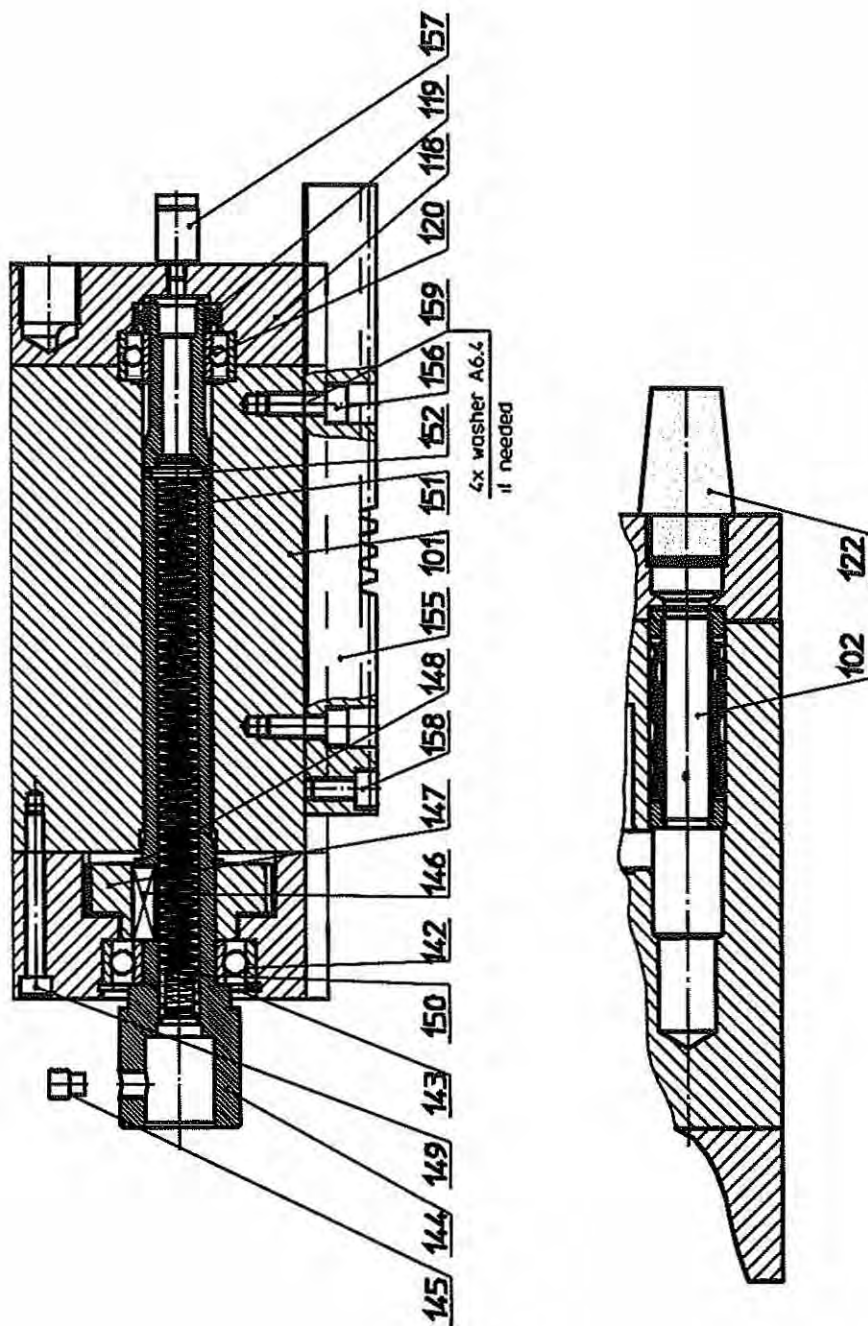


Spare Part List

Description:

Pneumatic Motor

Part and Drawing Number

2 1330 1000

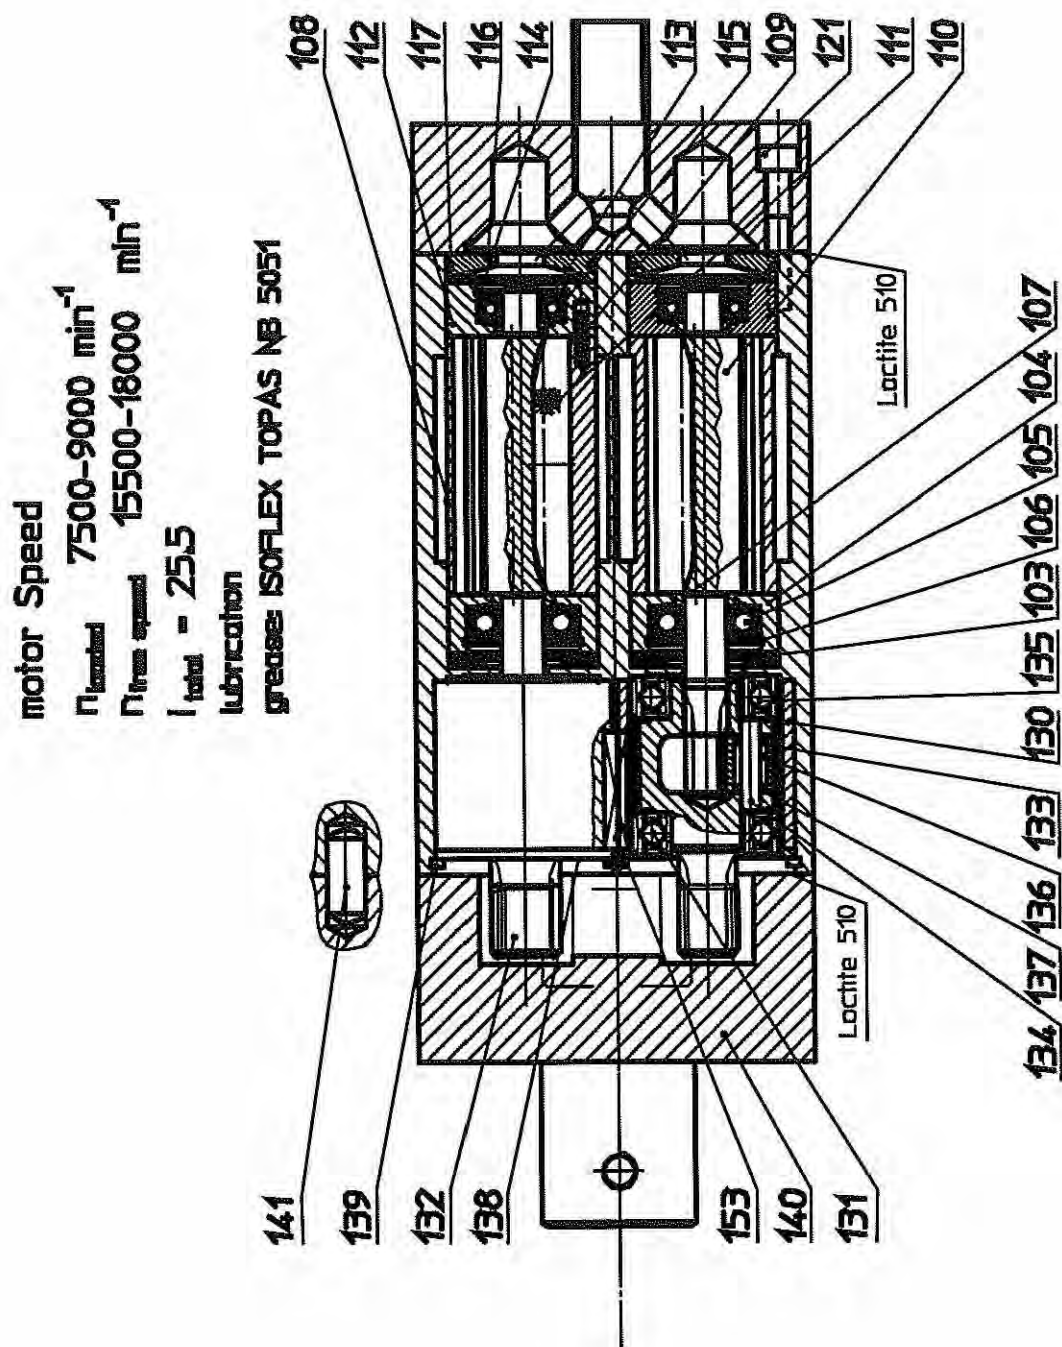




Spare Part List

Description:

Pneumatic Motor

Part and Drawing Number

2 1330 1000

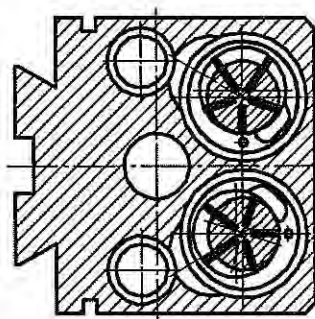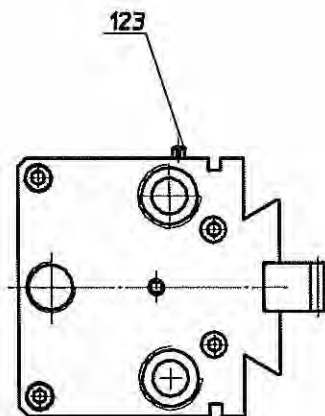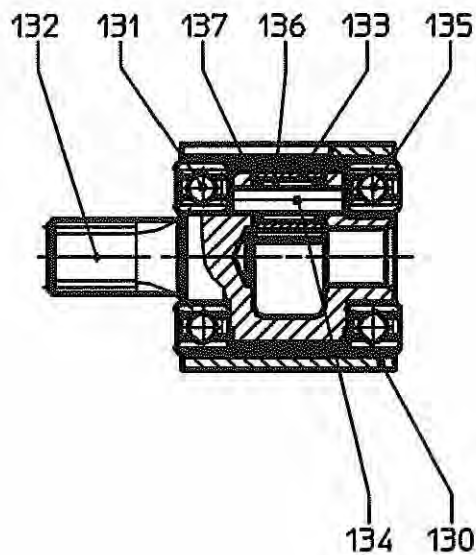


mount cylinder
bushing each with a
displacement of 90°

Description:

Part and Drawing Number

2 1330 3000

[illegible]

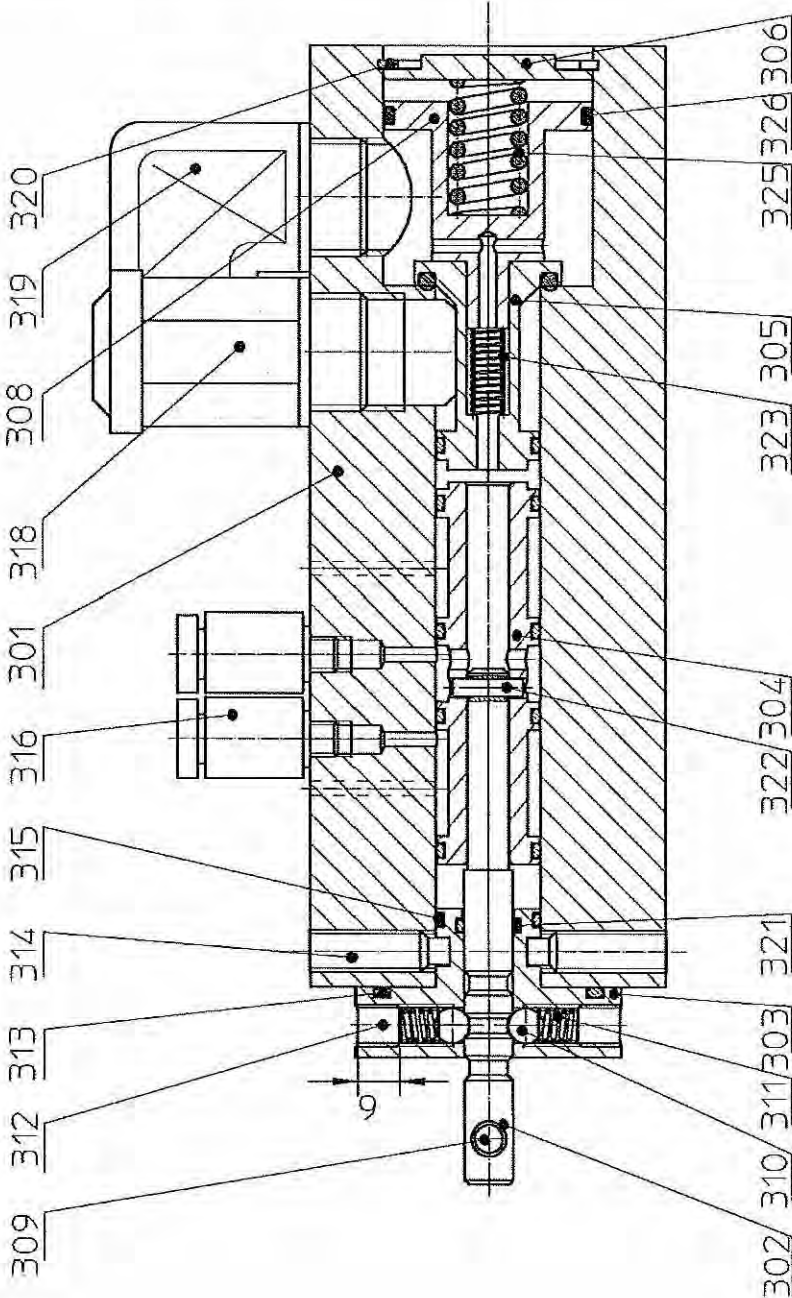Spare Part List		
Description:	Part and Drawing Number	
	2 1330 3000	
Valve, Assy.		
		

Spare Part List

Description:

Part and Drawing Number

2 1330 6000

Housing, Assy.

Item	Qty.	Description	Part and Drawing No.		Remarks
601	1	Housing	2 1330 6010		
602	1	Gear-shift fork	2 1330 3050		
603	1	Axis	2 1330 3060		
604	1	Control lever	2 1330 3030		
605	1	Feed shaft	2 1330 6040		
606	1	Lock washer	2 1330 6060		
607	2	Guide	2 1330 6050		
609	1	End Cap	2 1330 6100		
610	3	Handle bar	9 3902 0360		
611	1	Pneumatic Hose, Assy.	9 3606 0350		
612	1	Plastic hose	9 3602 0630		
613	1	Threaded pin	9 1146 2040		
614.1	1	Plastic hose	9 3602 0680		
614.2	1	Plastic hose	9 3602 0620		
616	4	Fillister-head Screw	9 1110 3100		
617	1	Adapter sleeve	9 1630 0590		
618	2	Bearing bushing	9 1029 0720		
619	2	Adjusting washer	9 3331 1550		
619	2	Adjusting washer	9 3331 1560		
620	1	Fillister-head Screw	9 1110 5110		
621	4	Washer	9 3302 0040		
622	2	Fillister-head Screw	9 1112 4070		
623	1	Pressure Piece	9 1810 0060		
624	2	Screw-in fitting straight	9 2113 0340		
625	2	Fillister-head Screw	9 1110 3110		
626	2	Adapter sleeve	9 1630 0240		
627	1	Pressure strip	2 1330 6080		
628	5	Thread pin with cone point	9 1146 3040		
629	5	Hexagonal nut	9 1210 0120		
630	1	Adapter piece	2 1330 6090		
631	1	Screw-in fitting straight	9 2113 0350		
632	1	Nipple	9 2115 0100		
634	1	Adjusting screw	9 1147 4050		
635	1	Adapter	2 1330 6110		
636	1	Cover	2 1330 9360		
637	2	Locking screw	9 1171 9230		


Spare Part List

Description:

Part and Drawing Number

Housing, Assy.

2 1330 6000

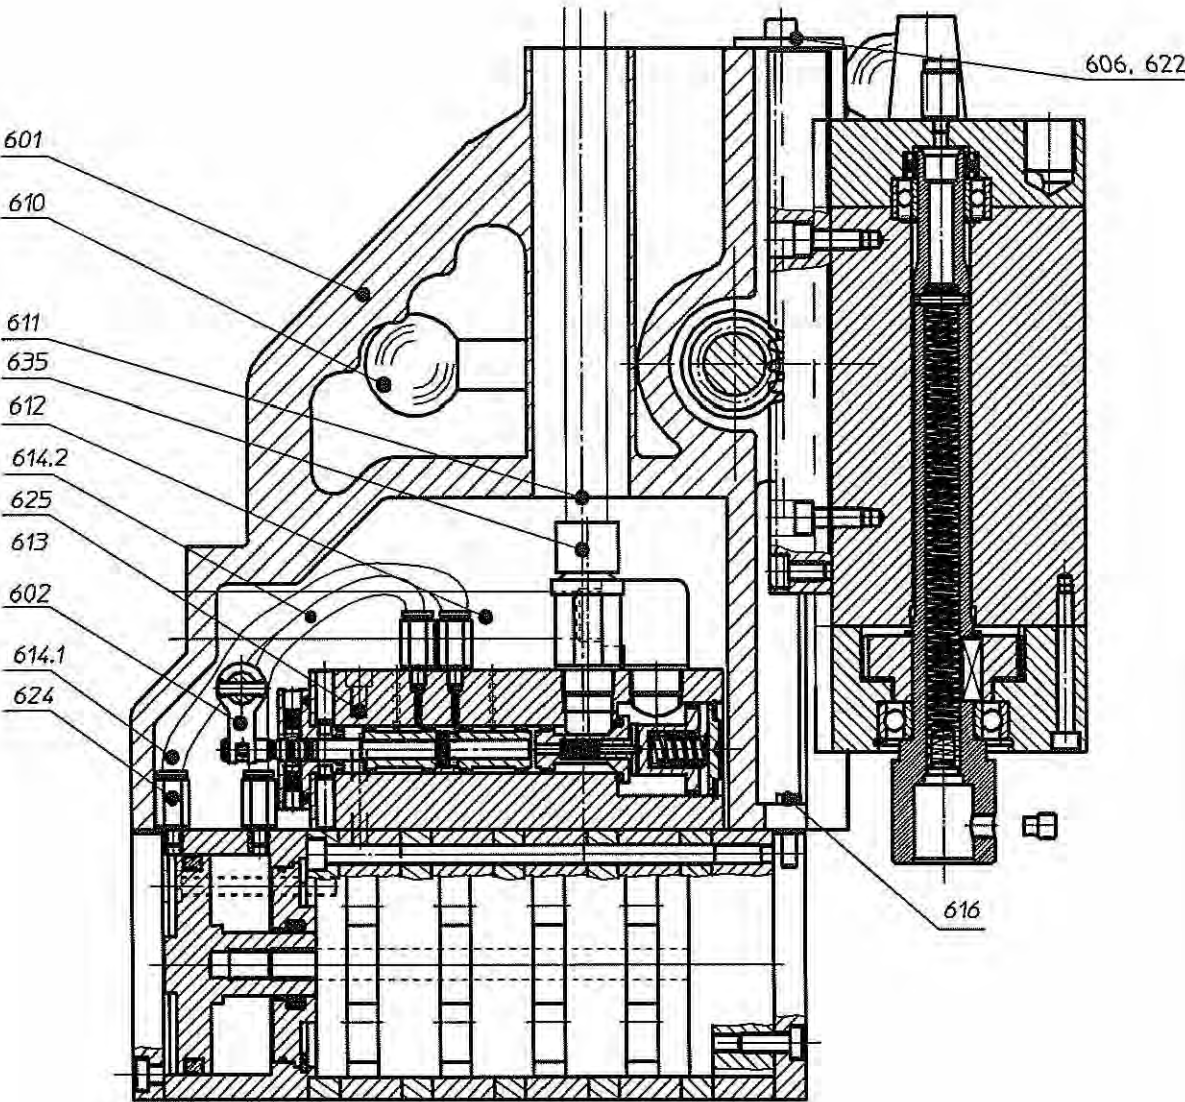


Spare Part List

Description:

Housing, Assy.

Part and Drawing Number

2 1330 6000

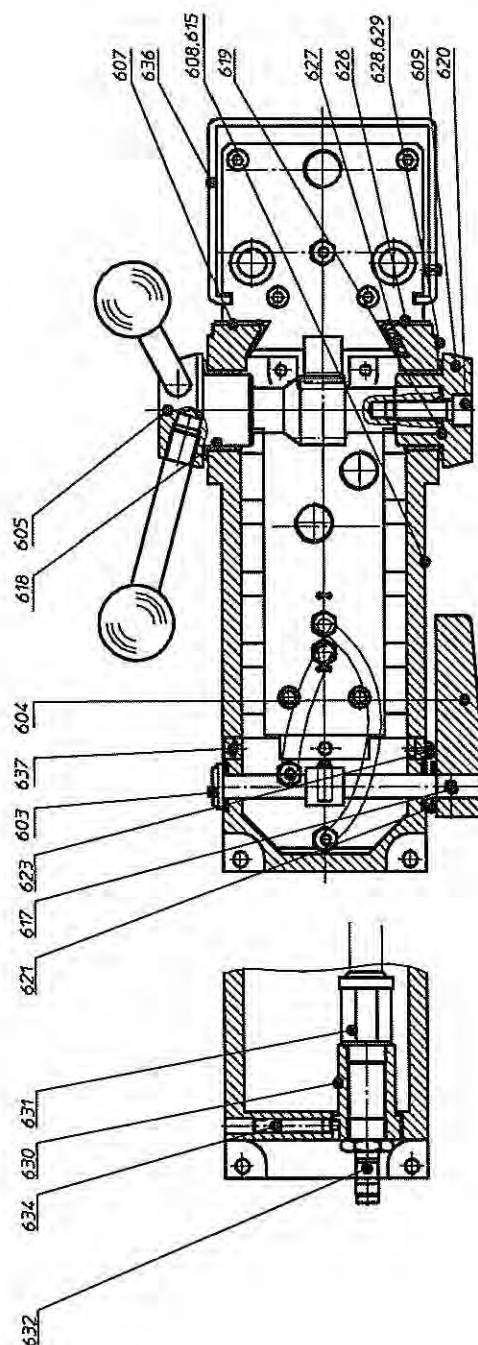




UNITEC

[illegible]

Spare Part List		
Description:	Part and Drawing Number	
	2 1330 8000	
	Magnet, Assy.	

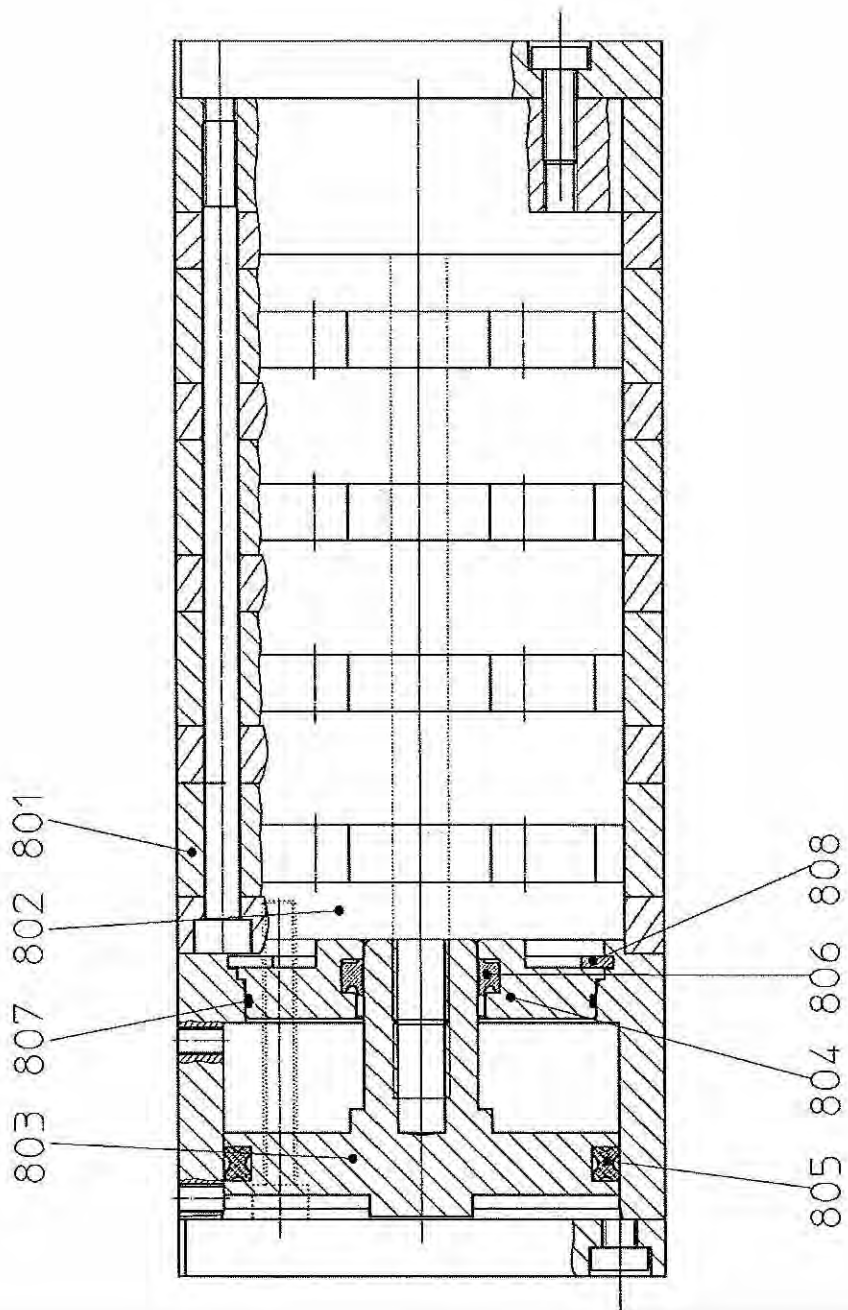

© 2006 The Authors
Journal compilation © 2006 Blackwell Publishing Ltd, *Journal of Internal Medicine* 260: 101–108



Spare Part List

Description:

Part and Drawing Number

2 1330 0040

Pneumatic- Magnetic Drilling Machine

[illegible]

[illegible]

Part and Drawing Number

Extension Rack

[illegible]

Spare Part List

Description:

Extension Rack

Part and Drawing Number

2 1330 9000

